




www.lamaneta.com
SERVICE SHEETS

BSA SERVICE SHEET No. 415A

July, 1955
Revised Nov. 1957

Fig. 1: 'C' GROUP MODELS VALVE TIMING CHART

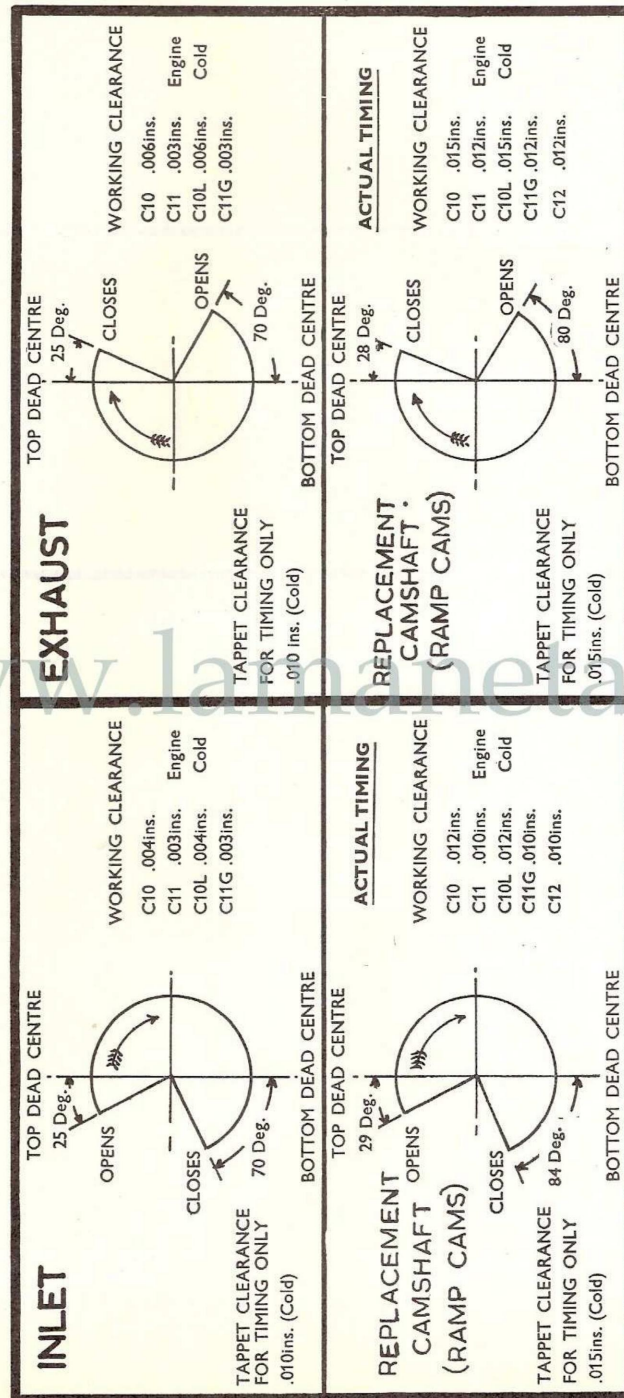

NOTE: Ramp type camshafts bear the following part numbers:-
C.10—29-2078; C.11—29-2075; C.11G—29-2076, and can be used to replace the original camshafts in early models.

They are fitted as standard on and after Engine numbers:-

BC.10L—3562 and BC.11G—10438.

When ramp cams are fitted, the inlet valve clearance must be checked or adjusted when the exhaust valve is about to open. The exhaust valve clearance must be checked or adjusted when the inlet valve has just closed.

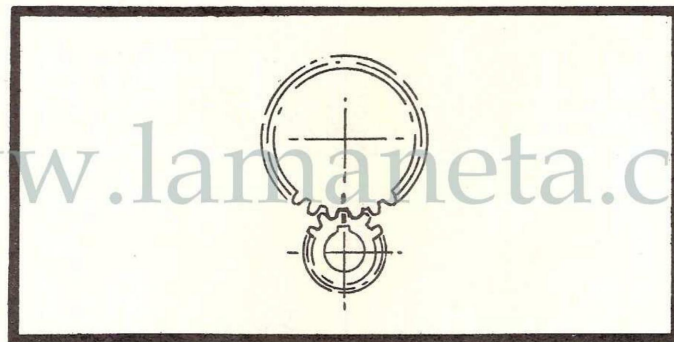


Fig. 2. VALVE TIMING MARKS